

JACKSON  
 N173  
 10-66

MISSISSIPPI BOARD OF WATER COMMISSIONERS

WATER WELL DRILLERS LOG

Date: 10-12, 1966, Driller C.T. Switzer Well Co. County Jackson  
45 (When well drilled) (Name) (Where well is located)

(1) Owner of Land: Jerry Fountain  
 (Name)  
Corner Spanish Trail Drive +  
old Hwy 90 in St. Martin  
 (Address) Comm.

(2) Location: NW 1/4, NE 1/4, Sec. 15 T7S R9W  
 (distance) (direction) (Nearest Town)

(3) Topography: X  
 (Hilly) (Flat) (Level)

(4) Purpose of Well: domestic  
 (Domestic Irrigation  
 Municipal, Industrial, Other)

Description & Color of Materials Sand, Clay, Red Clay, Shell, etc.	Thick- ness Feet	Depth Feet
<u>drilled deeper</u>		
<u>sand</u>	<u>104</u>	<u>161</u>
<u>clay</u>	<u>161</u>	<u>403</u>
<u>sand streaks</u>	<u>403</u>	<u>409</u>
<u>clay</u>	<u>409</u>	<u>439</u>
<u>rock</u>	<u>439</u>	<u>440</u>
<u>clay + shale</u>	<u>440</u>	<u>465</u>
<u>clay</u>	<u>465</u>	<u>483</u>
<u>sand</u>	<u>483</u>	<u>487</u>
<u>clay</u>	<u>487</u>	<u>558</u>
<u>sand</u>	<u>558</u>	<u>566</u>
<u>clay</u>	<u>566</u>	<u>613</u>
<u>clay</u>	<u>613</u>	<u>630</u>
<u>rock</u>	<u>630</u>	<u>633</u>
<u>clay</u>	<u>633</u>	<u>705</u>
<u>sand</u>	<u>705</u>	<u>713</u>
<u>clay</u>	<u>713</u>	<u>717</u>
<u>mixed</u>	<u>717</u>	<u>728</u>
<u>sand</u>	<u>728</u>	<u>756</u>
<u>sand + gravel w shale</u>	<u>756</u>	<u>777</u>
<u>clay w sand streaks</u>	<u>777</u>	<u>796</u>
<u>sand</u>	<u>796</u>	<u>803</u>
<u>good sand</u>	<u>803</u>	<u>831</u>

Information upon completion of well:

(1) Diameter 2 inches.

(2) Total Depth 831' feet.

(3) Water Level 6' + feet below top of ground.

(4) Cased to 831', Size 2"

(5) Screen: Size 10 ga SS 10'  
8 ga 8'

(6) Were any formations sealed against pollution?  
X yes,        no.

YES depth of formation \_\_\_\_\_


Health Dept. Comments \_\_\_\_\_

Drillers Remarks: \_\_\_\_\_

yield in gpm: \_\_\_\_\_

size pump: \_\_\_\_\_

Type power: \_\_\_\_\_

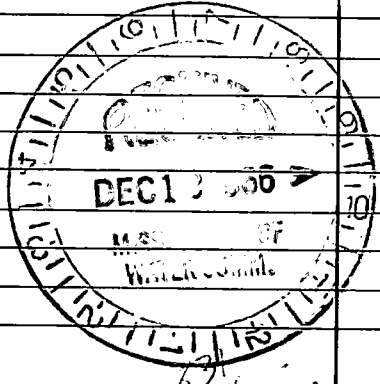

Mail this copy to Board of Water Commissioners 429 Miss. St. Jackson, Miss.

