

JACKSON MISSISSIPPI BOARD OF WATER COMMISSIONERS

② 9 180
6-11-65

3 Uses of Case

WATER WELL DRILLERS LOG

Date: June 11, 1965, Driller: Carloss Well Supply County Jackson

(Name)

(1) Owner of Land: Jackson County
(Name)
Board of Supervisors
Jackson County, Mississippi
(Address)
(2) Location: 1 3/4, 1/4, Sec. 30 T8 R5W
Bayou Casotte-Well #1
Pascagoula, Mississippi
(distance) (direction) (Nearest Town)
(3) Topography: Flat
(Hilly) (Flat) (Level)
(4) Purpose of Well: Municipal
(Domestic Irrigation, Municipal, Industrial, Other)


Description & Color of Materials Sand, Clay, Red Clay, Shell, etc.	Thick- ness Feet	Depth Feet
Top soil	5'	5'
Sand	5'	10'
Soft Clay	50'	60'
Sand	15'	75'
Sand, Small Gravel	25'	100'
Sand	34'	134'
Sand, Takes lots mud	29'	163'
Good Sand	30'	193'
Sand	25'	218'
Sandy Clay	6'	224'
Sand-Shale-cuts good	123'	347'
Hard clay-w/soft Sandy spots	61'	408'
Clay Streaks	90'	498'
Soft Clay-Sand	31'	529'
Hard Clay	51'	580'
Sand Streaks	33'	613'
Sand	48'	661'
Clay	2'	663'

Information upon completion of well:

(1) Diameter 10 inches.
(2) Total Depth 663 feet.
(3) Water Level 56 feet below top of ground.
(4) Cased to 614 feet, Size 10 inches
(5) Screen: Size 6 inches length 41' 2"
(6) Were any formations sealed against pollution?
X yes, _____ no.

If YES depth of formation Casing cemented
its entire length.
Why _____

Drillers Remarks: _____

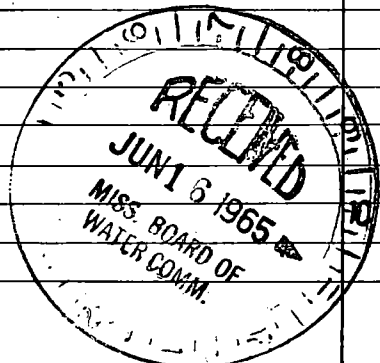

(Use Back Side)

Well No.

1957

1. The first part of the report is devoted to a general survey of the situation in the country. It is followed by a detailed analysis of the economic situation, which shows a steady decline in the standard of living of the population.

2. The second part of the report is devoted to a detailed analysis of the economic situation. It shows a steady decline in the standard of living of the population, which is due to a number of factors, including the lack of investment in infrastructure and the over-reliance on a single export commodity.

3. The third part of the report is devoted to a detailed analysis of the economic situation. It shows a steady decline in the standard of living of the population, which is due to a number of factors, including the lack of investment in infrastructure and the over-reliance on a single export commodity.

4. The fourth part of the report is devoted to a detailed analysis of the economic situation. It shows a steady decline in the standard of living of the population, which is due to a number of factors, including the lack of investment in infrastructure and the over-reliance on a single export commodity.

5. The fifth part of the report is devoted to a detailed analysis of the economic situation. It shows a steady decline in the standard of living of the population, which is due to a number of factors, including the lack of investment in infrastructure and the over-reliance on a single export commodity.

6. The sixth part of the report is devoted to a detailed analysis of the economic situation. It shows a steady decline in the standard of living of the population, which is due to a number of factors, including the lack of investment in infrastructure and the over-reliance on a single export commodity.

7. The seventh part of the report is devoted to a detailed analysis of the economic situation. It shows a steady decline in the standard of living of the population, which is due to a number of factors, including the lack of investment in infrastructure and the over-reliance on a single export commodity.

8. The eighth part of the report is devoted to a detailed analysis of the economic situation. It shows a steady decline in the standard of living of the population, which is due to a number of factors, including the lack of investment in infrastructure and the over-reliance on a single export commodity.