

M2

8-6-62

WATER WELL DRILLERS LOG

CODED

Date: 8-6-, 1962, Driller: Smith & Prasley County Montgomery  
 (Name)

(1) Owner of Land: Hebron Church  
 (Name)  
 (Address)  
 (2) Location: SW 1/4, SW 1/4, Sec 30 T12R7,  
 \_\_\_\_\_ miles \_\_\_\_\_ of \_\_\_\_\_  
 (distance) (direction) (Nearest Town)  
 (3) Topography: Hilly  
 (Hilly) (Flat) (Level)  
 (4) Purpose of Well: Domestic  
 (Domestic Irrigation  
 Municipal, Industrial, Other)

Description & Color of Materials Sand, Clay, Red Clay, Shell, etc.	Thick- ness Feet	Depth Feet
red clay	6	6
sand rock	4	10
red clay sand	10	20
sand track	2	22
red clay sand	11	35
hard sandrock		
about	6	41
white sand	43	84
yellow coarse sand		
mixed with clay	21	105
reddish sand clay		
mixture	5	110
black clay	10	120
white sand black		
clay mixture	18	138
yellow and black	9	147
clay mixture	9	156
thin yellow rock		
blue clay	6	162
blue rock also	5"	
yellow sand blue		
clay mixture	18	180
thin rock	3"	
coarse sand white	18	198
white coarse sand	6	204


Information upon completion of well:

(1) Diameter 2 inches.  
 (2) Total Depth 190 feet.  
 (3) Water level about 138 feet below top of ground.  
 (4) Cased to 147, Size 2"  
 (5) Screen: Size 1/4 x 6", Length 6'  
 (6) Were any formations sealed against pollution?  
 \_\_\_\_\_ yes, No no.

If YES depth of formation \_\_\_\_\_

Why \_\_\_\_\_

Drillers Remarks: \_\_\_\_\_

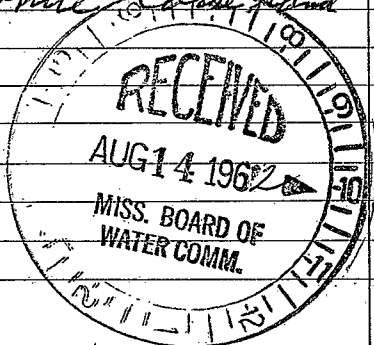

(Use Back Side)

