

PANOLA
T-209

MISSISSIPPI
 BOARD OF WATER COMMISSIONERS
 416 North State Street
 Jackson, Mississippi 39201

WATER WELL DRILLERS LOG

4-22-92 19 Lige Well Supply Panola
 date well completed firm name county well located


LANDOWNER: Jesse Butler
Rt 1 Box 79
Batesville, MS 38606
 (mailing address)

description of formations encountered	from	to
top soil, hard clay	0	20
hard clay, sandst 2'	20	40
sand	40	60
sandy rock at 68'	60	80

WELL LOCATION:
 sec. 19 T. 9 N. R. 5 E.
13 miles E of Batesville
 (distance) (direction) (nearest town)

WELL PURPOSE: None
 (home, irrigation, municipal, industrial)

- WELL COMPLETION DATA:
- (1) diameter (inches) 4"
 - (2) total depth (feet) 108
 - (3) static water level (feet) 37' below top of ground.
 - (4) casing PVC 58
 (material) (depth)
4" if telescope see back.
 (size)
 - (5) screen 10 88
 (length) (depth to top)
4" PVC
 (size) (material)
 - (6) pump 1/2 10
 (HP) (yield gpm)
elec.
 (type power)
 - (7) electric log no
 (yes or no)
 - (organization running log) ✓
 - (8) how well bottom plugged cap

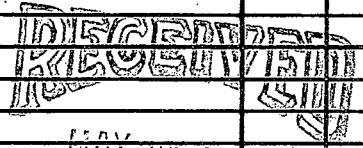


MAY 17 1992

DRILLERS REMARKS:

Dept. of Environmental Quality
 Bureau of Land & Water Resources

If well telescopes please sketch and show depths.

GROUND LEVEL

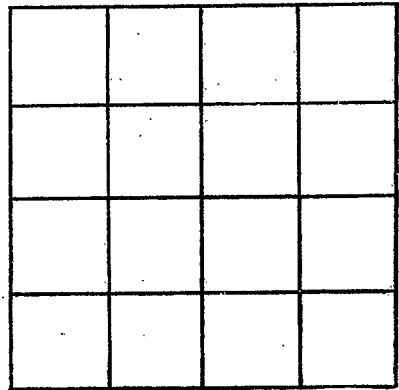

SECTION _____

Please indicate well location X.

ADDITIONAL INFORMATION

If more than one screen, show locations of each on sketch.